



REV #	DATE	REVISION
7	7/17/91	ECO #301 AND ECO #434 REPLACED EYE WITH D47 SO +12 IS NOT BRAGGED DOWN BY BATTERY SUPPLY WHILE C77 DISCHARGES RAPIDLY AT WHEN UNIT IS TURNED OFF. THIS PREVENTS BY LOCKOUT ON IC7, WHICH CAUSES IT TO PUT OUT DC.
8, 9	8/10/91	ECO #412 AND ECO #413 Q10 BSS100'S HAD STATIC PROBLEMS ON ASSEMBLY LINE. Q10A BZT71 IS USED INSTEAD.
10	9/6/91	ECO #415 ADDED C54=CLAMP TO PREVENT IC7 "HICUP" DUE TO NOISE ON +5 DURING RELAY SWITCHING.

REV #	DATE	REVISION
7	7/17/91	ECO #301 AND ECO #434 REPLACED EYE WITH D47 SO +12 IS NOT BRAGGED DOWN BY BATTERY SUPPLY WHILE C77 DISCHARGES RAPIDLY AT WHEN UNIT IS TURNED OFF. THIS PREVENTS BY LOCKOUT ON IC7, WHICH CAUSES IT TO PUT OUT DC.
8, 9	8/10/91	ECO #412 AND ECO #413 Q10 BSS100'S HAD STATIC PROBLEMS ON ASSEMBLY LINE. Q10A BZT71 IS USED INSTEAD.
10	9/6/91	ECO #415 ADDED C54=CLAMP TO PREVENT IC7 "HICUP" DUE TO NOISE ON +5 DURING RELAY SWITCHING.

REV #	DATE	REVISION
7	7/17/91	ECO #301 AND ECO #434 REPLACED EYE WITH D47 SO +12 IS NOT BRAGGED DOWN BY BATTERY SUPPLY WHILE C77 DISCHARGES RAPIDLY AT WHEN UNIT IS TURNED OFF. THIS PREVENTS BY LOCKOUT ON IC7, WHICH CAUSES IT TO PUT OUT DC.
8, 9	8/10/91	ECO #412 AND ECO #413 Q10 BSS100'S HAD STATIC PROBLEMS ON ASSEMBLY LINE. Q10A BZT71 IS USED INSTEAD.
10	9/6/91	ECO #415 ADDED C54=CLAMP TO PREVENT IC7 "HICUP" DUE TO NOISE ON +5 DURING RELAY SWITCHING.

DESCRIPTION	SHEET
AMERICAN POWER CONVERSION	A
SB208 CIRCUIT BOARD SCHEMATIC	
PRODUCT	
250/400/600 INT'L BACK-UPS	
REV#	
3/22/91	
BY	
ESM	
SCALE	
E208-10	
REV#	
10	